

Work Order ID 77411***77411***

Page 1

Item.ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 06/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: M.L.J.Date: 11/12/06

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

Draw Nbr

Revision Nbr

D3391

I

100

0.00

100

Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1-Cut tube to finish length as per Dwg D3391

2-Identify as D3391-023

3-Drill pilot holes using DT8796 (Do not drill "B" holes) and drill only 1 fwd saddle hole on one side only as per Dwg D3391

4-Open saddles and GHW holes to Ø0.375" except for fwd saddle hole of detail "J"

5-Remove .030" from Fwd indexing Ridge as per Dwg D3391


6-Remove indexing ridge on Fwd & Aft end of skidtube as per Dwg D3391

7-Debur

8-Drill #30 pilot holes using wearplate Jig DT8217 Identify Ø0.250" holes with paint marker,

9-Open wearplate holes of D3391-023 assembly detail section G-G to Ø0.250" (14 holes) as per Dwg D3391 and 2 holes in section Detail "J", do not open wearplate holes of section "J"

10-Open wearplate holes of D3391-023 assembly detail section H-H to Ø0.297" (20 holes) as per Dwg D3391

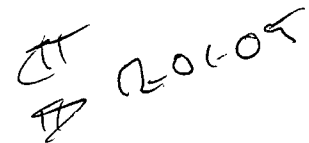

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77411

December-06-11 1:49:48 PM

77411

Page 2

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 06/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

11-Open .375" holes to .438" ***do not open fwd saddle holes***

12-Locate D3391-021 in D3391-023 at 9.00" (see view z-z)

13- Transfer drill one fwd saddle hole only to .188" dia, transfer drill all remaining fwd saddle holes using DT 8149 locating from previously drill .188" dia hole, using t-pins and clicos to ensure perfect allingment, open up previously tranfer drilled pilot holes in D3391-023/-021 to 0.438" dia. in D3391-021

14- Transfer drill 2 wearplate holes into D3391-021 using DT8217, locating from two previously drilled holes, drill remaining wearplate holes into D3391-021.

15- Locating from two fwd wearplate holes drilol remaining 6 wearplte holes in D3391-021 using DT8937

16- Open 2 fwd wearplate holes in D3391-023 to .250" dia.

17- counterbore two aft wearplate holes in D3391-021 as per dwg

18- Open 12 wearplate holes in D3391-021 to 0.297" dia.

19-Deburr and blow out all chips from inside tube

ET 12-01-09

ET 12-01-09

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77411

December-06-11 1:49:48 PM

Reference:

Run	Start	*NR1*
	Stop	*NR2*

[illegible]

Dart Aerospace Ltd

W/O: 1		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77411

December-06-11 1:49:48 PM

77411

Page 4

Item ID: D3391-023 Accept ***N900040100*** Setup Start ***NS1***
 Revision ID: Stop ***NS2***
 Item Name: Mid Tube Assembly
 Start Date: 06/12/2011 Start Qty: 1.00 ***1*** Cust Item ID:
 Required Date: 13/12/2011 Req'd Qty: 1.00 ***1*** Customer:
 Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____ Run Start ***NR1***
 QC: _____ Date: _____ SPC (Y/N): _____ Date: _____ Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
140	Skidtubes	0.00							
140									
Skidtubes	Memo	0.00							
Skidtubes	1-Open float bag holes as per dwg 2-C'sink float bag holes as per dwg 3- Prepare tube for welding 4-Bond web in place as per Dwg D3391 & QSI 015. Adhere for 12 hours) A/R Sikaflex exp: <u>12-08-17</u> batch#: <u>M119508</u>	0.00							
150	QC5- Inspect part completeness to step on W/O	0.00							
150									
QC	Memo	0.00							
Quality Control									
160	Skidtubes	0.00							
160									
Skidtubes	Memo	0.00							
Skidtubes	1-Weld crossbolt spacer as per dwg D3391 & QSI 004 2-grind weld flush	0.00							

A/R M119712
 12/01/12

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77411***77411***

Page 5

December-06-11 1:49:48 PM

Item ID: D3391-023
Revision ID:
Item Name: Mid Tube Assembly

Accept

N900040100Setup Start ***NS1***Stop ***NS2***Start Date: 06/12/2011 Start Qty: 1.00 ***1***

Cust Item ID:

Required Date: 13/12/2011 Req'd Qty: 1.00 ***1***

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____
QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Run Start ***NR1***Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
170 *170* QC Quality Control	QC10- Inspect visual per QSI004- ground welds Memo	0.00 0.00		5126116					
180 *180* QC Quality Control	QC5- Inspect part completeness to step on W/O Memo	0.00 0.00		5126116					
185 *185* HandFinish Hand Finishing	Pressure Wash per QSI005 4.3 Memo AND REALODINE AS PER PAR09-043	0.00 0.00							

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77411***77411***

Page 6

December-06-11 1:49:48 PM

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 06/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan: _____

Date: _____

Tooling: _____

Date: _____

Run Start ***NR1***

QC: _____

Date: _____

SPC (Y/N): _____

Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
190	White Gloss(Ref:4.3.5.1) per QSI005 4.3-Alum	0.00							
190									
Powdercoat		0.00							
Powder Coating									
M119480									
	Memo								
	START TIME: 1:00								
	OVEN TEMPERATURE: 320 °F								
	FINISH TIME: 1:30								
200	QC3- Inspect Part Finish	0.00							
200									
QC		0.00							
Quality Control	Memo								

1X of m-p 12/04/16

1 of m 12/01/16

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77411

December-06-11 1:49:48 PM

77411

Page 7

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 06/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

210

0.00

210

Skidtubes

Skidtubes

Memo

0.00

Skidtubes

1- insert D3391-021 into D3391-23

2- insert T-pins into first and third fwd saddle holes

3- ON FIRST SIDE ONLY drill out 2nd and forth fwd saddles holes to 0.500" as per DSI 9364

4- remove T-pins and locate DT9415 from first and third crossbolt hole using T-pins and clekos

5- ON 2ND SIDE ONLY ream out 2nd and forth saddle hole to 0.499". Remove DT9415

6- deburr, re-alodine and blow out chips

7- press fit D3591-1 spacers using DT9416 starting from 0.500" side

1 ϕ 12/06/11

220

QC5- Inspect part completeness to step on W/O

0.00

220

QC

Memo

0.00

Quality Control

5/12/11

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77411***77411***

Page 8

December-06-11 1:49:48 PM

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 06/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals: Process Plan: _____ Date: _____ Tooling: _____ Date: _____

Run Start ***NR1***

QC: _____ Date: _____ SPC (Y/N): _____ Date: _____

Stop ***NR2***

Sequence ID/ Work Center ID	Operation Description	Set Up/ Run Hours	Tool ID	Tool #	Plan Code	Accept Qty	Reject Qty	Reject Number	Insp. Stamp
--------------------------------	--------------------------	----------------------	---------	--------	--------------	---------------	---------------	------------------	----------------

230

0.00

230

HandFinishing

HandFinish

Memo

0.00

Hand Finishing

Install Inserts as per Dwg

1 0 All 12/06/11

240

0.00

240

QC5- Inspect part completeness to step on W/O

QC

Memo

0.00

Quality Control

8/12/06/11

250

0.00

250Identify as per dwg & Stock Location: W/O

Packaging

Memo

0.00

Packaging

2112-742-043/1375904

1 0 All 12/06/11

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Work Order ID 77411***77411***

Page 9

December-06-11 1:49:48 PM

Item ID: D3391-023

Accept

N900040100Setup Start ***NS1***

Revision ID:

Stop ***NS2***

Item Name: Mid Tube Assembly

Start Date: 06/12/2011 Start Qty: 1.00

1

Cust Item ID:

Required Date: 13/12/2011 Req'd Qty: 1.00

1

Customer:

Reference:

Approvals:

Process Plan:

Date:

Tooling:

Date:

Run Start ***NR1***

QC:

Date:

SPC (Y/N):

Date:

Stop ***NR2***Sequence ID/
Work Center IDOperation
DescriptionSet Up/
Run Hours

Tool ID

Tool #

Plan
CodeAccept
QtyReject
QtyReject
NumberInsp.
Stamp

260

QC21- Final Inspection - Work Order Release

0.00

260

QC

Memo

0.00

Quality Control

12/11/23

P12-01-20

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

December-06-11 1:49:51 PM

Page 1

Work Order ID: 77411

77411

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 06/12/2011

Required Date: 13/12/2011

Start Qty: 1.00

Required Qty: 1.00

Comments: IPP A05.10.20New Issue KJ/EC
 IPP B06.02.10ECN773 dwg rev.D EC
 IPP C 07.03.20 rev F dwg EC
 IPP D 07.03.28 re-format EC
 IPP E 07.10.31 ecn 1053P EC
 IPP Rev:F ECN 1056 07-11-13 DD verified by: EC
 IPP Rev:G 08-09-08 new process (ecn 08-510) DD verified by:EC
 IPP Rev:H 08-09-10 revH as per dwg DD verified by:EC
 IPP Rev: I 08-11-13 Removed steps per w/o, QC KJ verified by: ec IPP
 Rev:J add in seq 140 expire date &b# sikaflex DD 10.02.17 verified by:EC

Component Item ID/ Item Name	Replacement Item ID	Mfg/ Purch	Bin Item	Primary Location	Last Location	Route Seq ID	Unit of Measure	Qty on Hand	Qty per Kit	Total Qty	Qty Issued	Date Issued	Status
D2500-1-100		Manufactured	No			100	Each	54.0000	1	1			
D2500-1-100									**			25 12-01-09	
Skidtube Extrusion													
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				HALL		54							
				50251		54				X1			
D3391-021		Manufactured	No			100	Each	0.0000	1	1			
D3391-021									**			25 12-01-09	
Fwd Tube Assembly													
D3389-1		Manufactured	No			140	Each	2.0000	1	1			
D3389-1									**			25 12-01-11	
Web													
				<u>Location</u>		<u>Loc Qty</u>		<u>Loc Code</u>					
				LG		2							
				76209		2							

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Picklist Print

Page 2

December-06-11 1:49:51 PM

Work Order ID: 77411

77411

Parent Item: D3391-023

D3391-023

Parent Item Name: Mid Tube Assembly

Start Date: 06/12/2011

Required Date: 13/12/2011

Start Qty: 1.00

Required Qty: 1.00

D3681-1 Manufactured No

160 Each 64.0000 5 5

D3681-1

Spacer

**

BE12-01-12

Location

Loc Qty

Loc Code

LG001

64

68958

2

69893

2

71845

2

74874

33

76004

25

5

D3591-1 Manufactured No

210 Each 33.0000 2 2

D3591-1

Bushing

**

B77570 (x2) M 12/01/16

Location

Loc Qty

Loc Code

ST068

33

57350

1

66147

4

71847

28

ALS4-1032-130 Purchased No

230 Each 2,176.000 20 20

ALS4-1032-130

Insert

**

M 12/01/16

Location

Loc Qty

Loc Code

ST280

1976

119084

1976

ST281

200

119632

200

X20

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

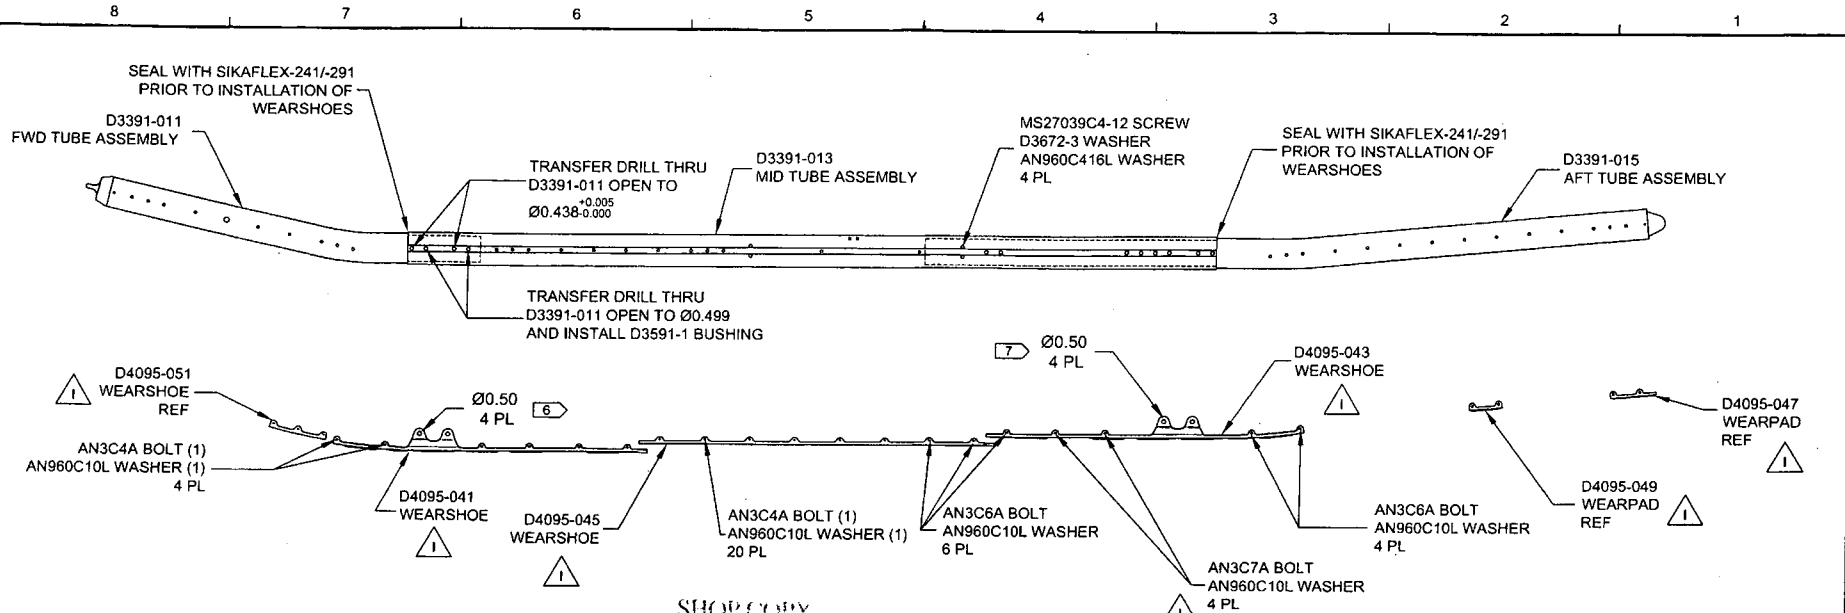

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
WORK ORDER
NO. 77411 M.C.J.
11/12/06

RELEASED
2011-11-04
ECN# H-662

D3391-041 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
-041		
X	D3391-041	FLOAT SKIDTUBE ASSEMBLY
1	D3391-011	FWD TUBE ASSEMBLY
1	D3391-013	MID TUBE ASSEMBLY
1	D3391-015	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
4	D3672-3	WASHER
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARPAD
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER
4	MS27039C4-12	SCREW
4	AN960C416L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES
FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT
WHERE INDICATED.
- 6) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
- 7) FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH
THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND
TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

I	REMOVE GASKETS AND REPLACE ALL WEARSHOES; PARTS LIST UPDATE, ZN A8-1, ZN A8-2, ZN A6-4, ZN B6-8; LPS-3 COATING REMOVED FROM NOTE 2, ZN A3-1, ZN A3-2, REMOVED INSERT AELS-1032-130, ZN B6-4, B2-4, C7-8, C3-8; REMOVED HOLES, ZN D6-4 ZN D2-4, ZN D7-8, ZN D3-8	XDF	11.10.13
H	DRAWING UPDATED TO CURRENT STANDARDS. SHT 1 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. SHT 2 PL ADDED D3591-1 BUSHING. ZN C6 Ø0.438 DIM WAS 4 PL. ADDED Ø0.499 DIM AND D3591-1 BUSHING. (FOR FURTHER INFO SEE DSI 9364 & NCR 08-074)	AJS	08.08.20
G	REPLACE NAS INSERTS W/ AELS INSERTS SWITCH TO D3670-XXXX SPACERS FOR INSTALLING FLOAT BAGS, DWG REORGANIZED FOR CLARITY	DC	07.07.31
F	ADD SS WEARSHOE, GASKET REMOVE FWD SADDLE HOLE -011/-021	PH	07.01.18
E	CHANGE TOLERANCE, EASE MANUFACTURE	PH	06.04.25
D	UPDATE TOLERANCE, CHANGE HOLE SIZE	PH	06.01.23
C	LENGTHEN AFT EXTENSION	PH	05.09.27
B	DRAWING UPDATES	PH	05.06.10
A	NEW ISSUE	PH	05.02.07
REV.	DESCRIPTION	BY	DATE
DESIGN	PH		
DRAWN	XDF		
CHECKED			
MFG. APPR.			
APPROVED			
DE APPR.			
DATE	11.10.13		
DART AEROSPACE USA, INC KENT, WA DRAWING NO. D3391 TITLE 412 FLOAT SKIDTUBE REV. I SHEET 1 OF 8 SCALE NTS COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77411

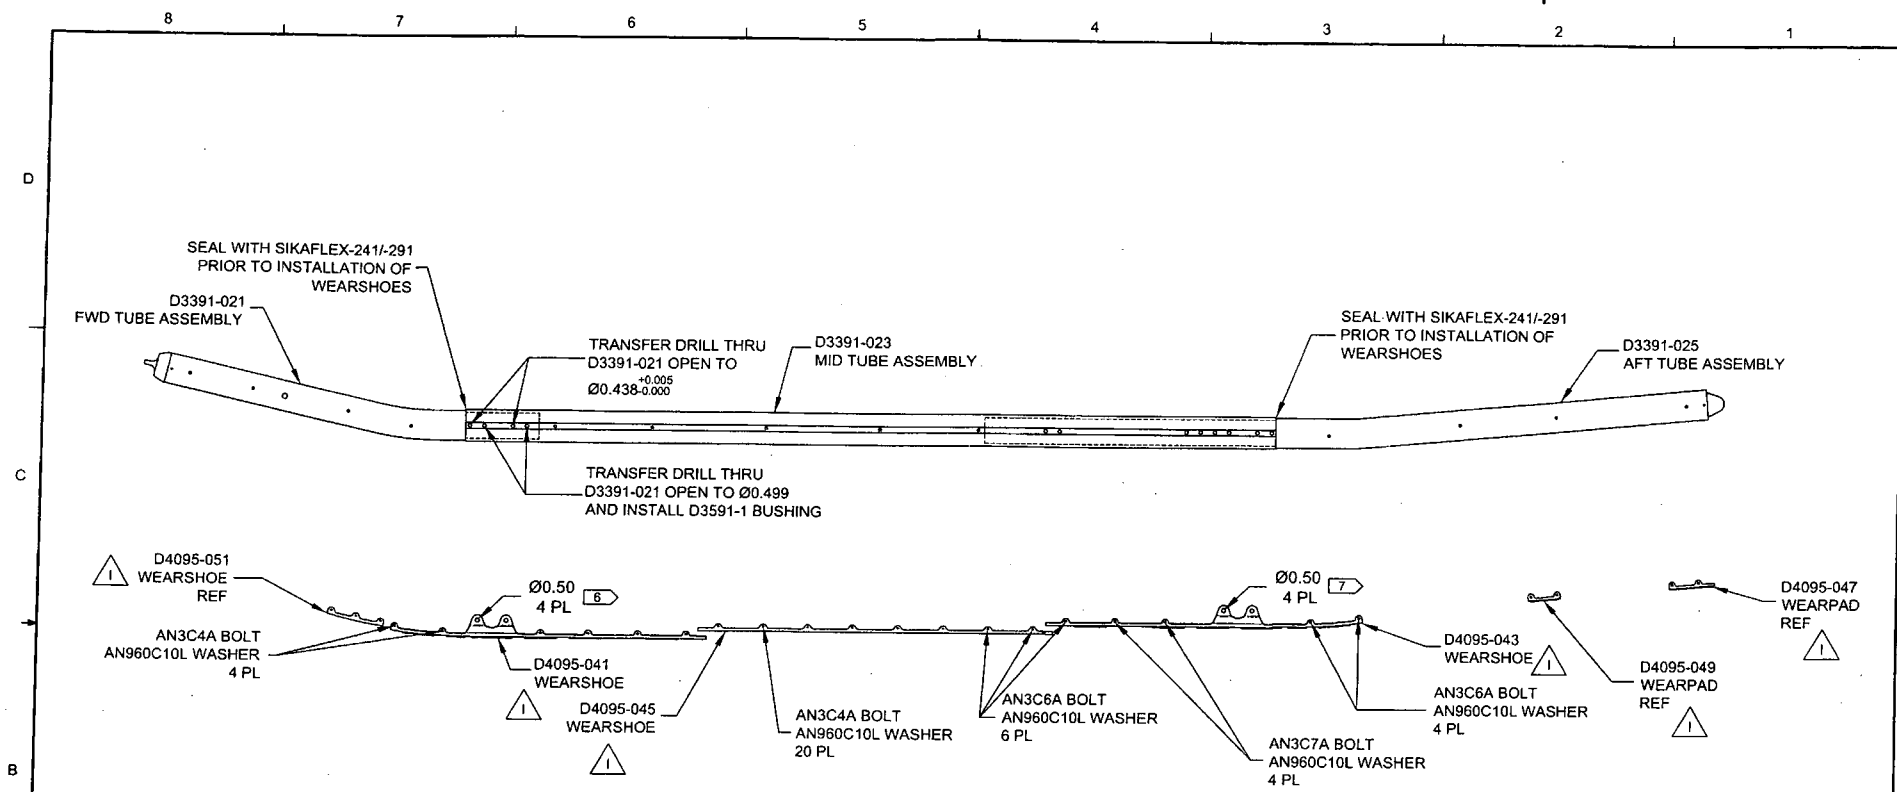

D3391-043 ASSEMBLY

D3391-043 FLOAT SKIDTUBE ASSEMBLY PARTS LIST

QTY -043	PART NUMBER	DESCRIPTION
X	D3391-043	FLOAT SKIDTUBE ASSEMBLY
1	D3391-021	FWD TUBE ASSEMBLY
1	D3391-023	MID TUBE ASSEMBLY
1	D3391-025	AFT TUBE ASSEMBLY
2	D3591-1	BUSHING
1	D4095-041	WEARSHOE
1	D4095-043	WEARSHOE
1	D4095-045	WEARSHOE
1	D4095-047	WEARPAD
1	D4095-049	WEARPAD
1	D4095-051	WEARSHOE
24	AN3C4A	BOLT
10	AN3C6A	BOLT
4	AN3C7A	BOLT
38	AN960C10L	WASHER

GENERAL NOTES

- 1) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 2) COAT ALL EXPOSED FASTENERS WITH LPS LABORATORIES "LPS PROCYON"
- 3) AFTER FINAL ASSEMBLY, CLEAN EXCESS OFF POWDER COATING WITH MEK DEGREASER.
- 4) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 5) UNITS: INCHES UNLESS OTHERWISE NOTED
- 6) USE DART DRILL TEMPLATE DT8217 TO LOCATE AND DRILL Ø0.297 SIZE HOLES FOR WEARSHOE INSERTS. C'BORE AS NOTED AND INSTALL INSERTS EXCEPT WHERE INDICATED.
- 7) FIT D4095-041 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-041
FIT D4095-043 TO SKIDTUBE WITH D2571 AND D2572 SADDLES INSTALLED WITH THE APPROPRIATE HARDWARE AND SPACERS IN FORWARD AND AFT HOLES AND TRANSFER DRILL Ø0.50 HOLES FROM SADDLE TO D4095-043

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 2 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Dart Aerospace Ltd


W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____
 Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


77411

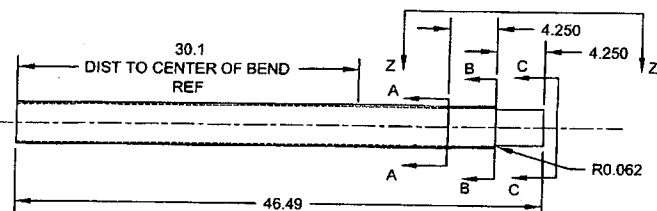


D3391-1 CUTTING DETAIL
(MAKE FROM D6013-047 SKIDTUBE MATERIAL)

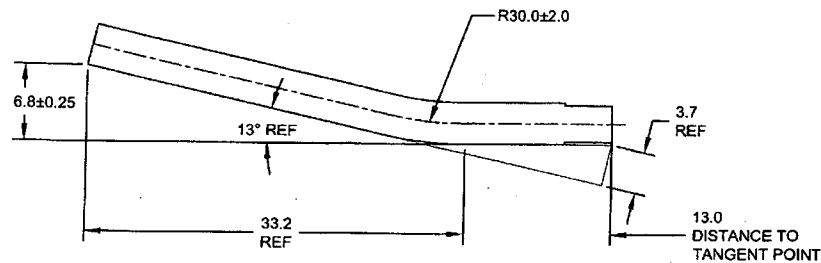


D3391-011/-021 BENDING DETAIL
(MAKE FROM D3391-1)

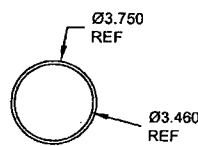


SECTION A-A
SCALE 2X

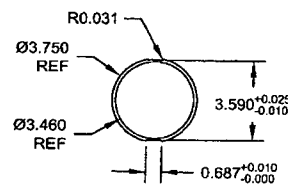

SECTION B-B
SCALE 2X

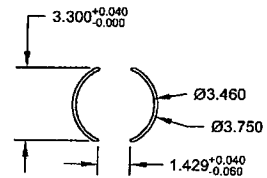

SECTION C-C
SCALE 2X

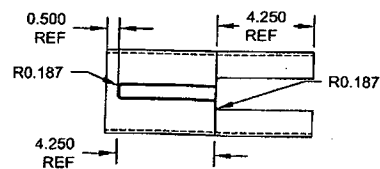

VIEW Z-Z
SCALE 2X

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 3 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77411

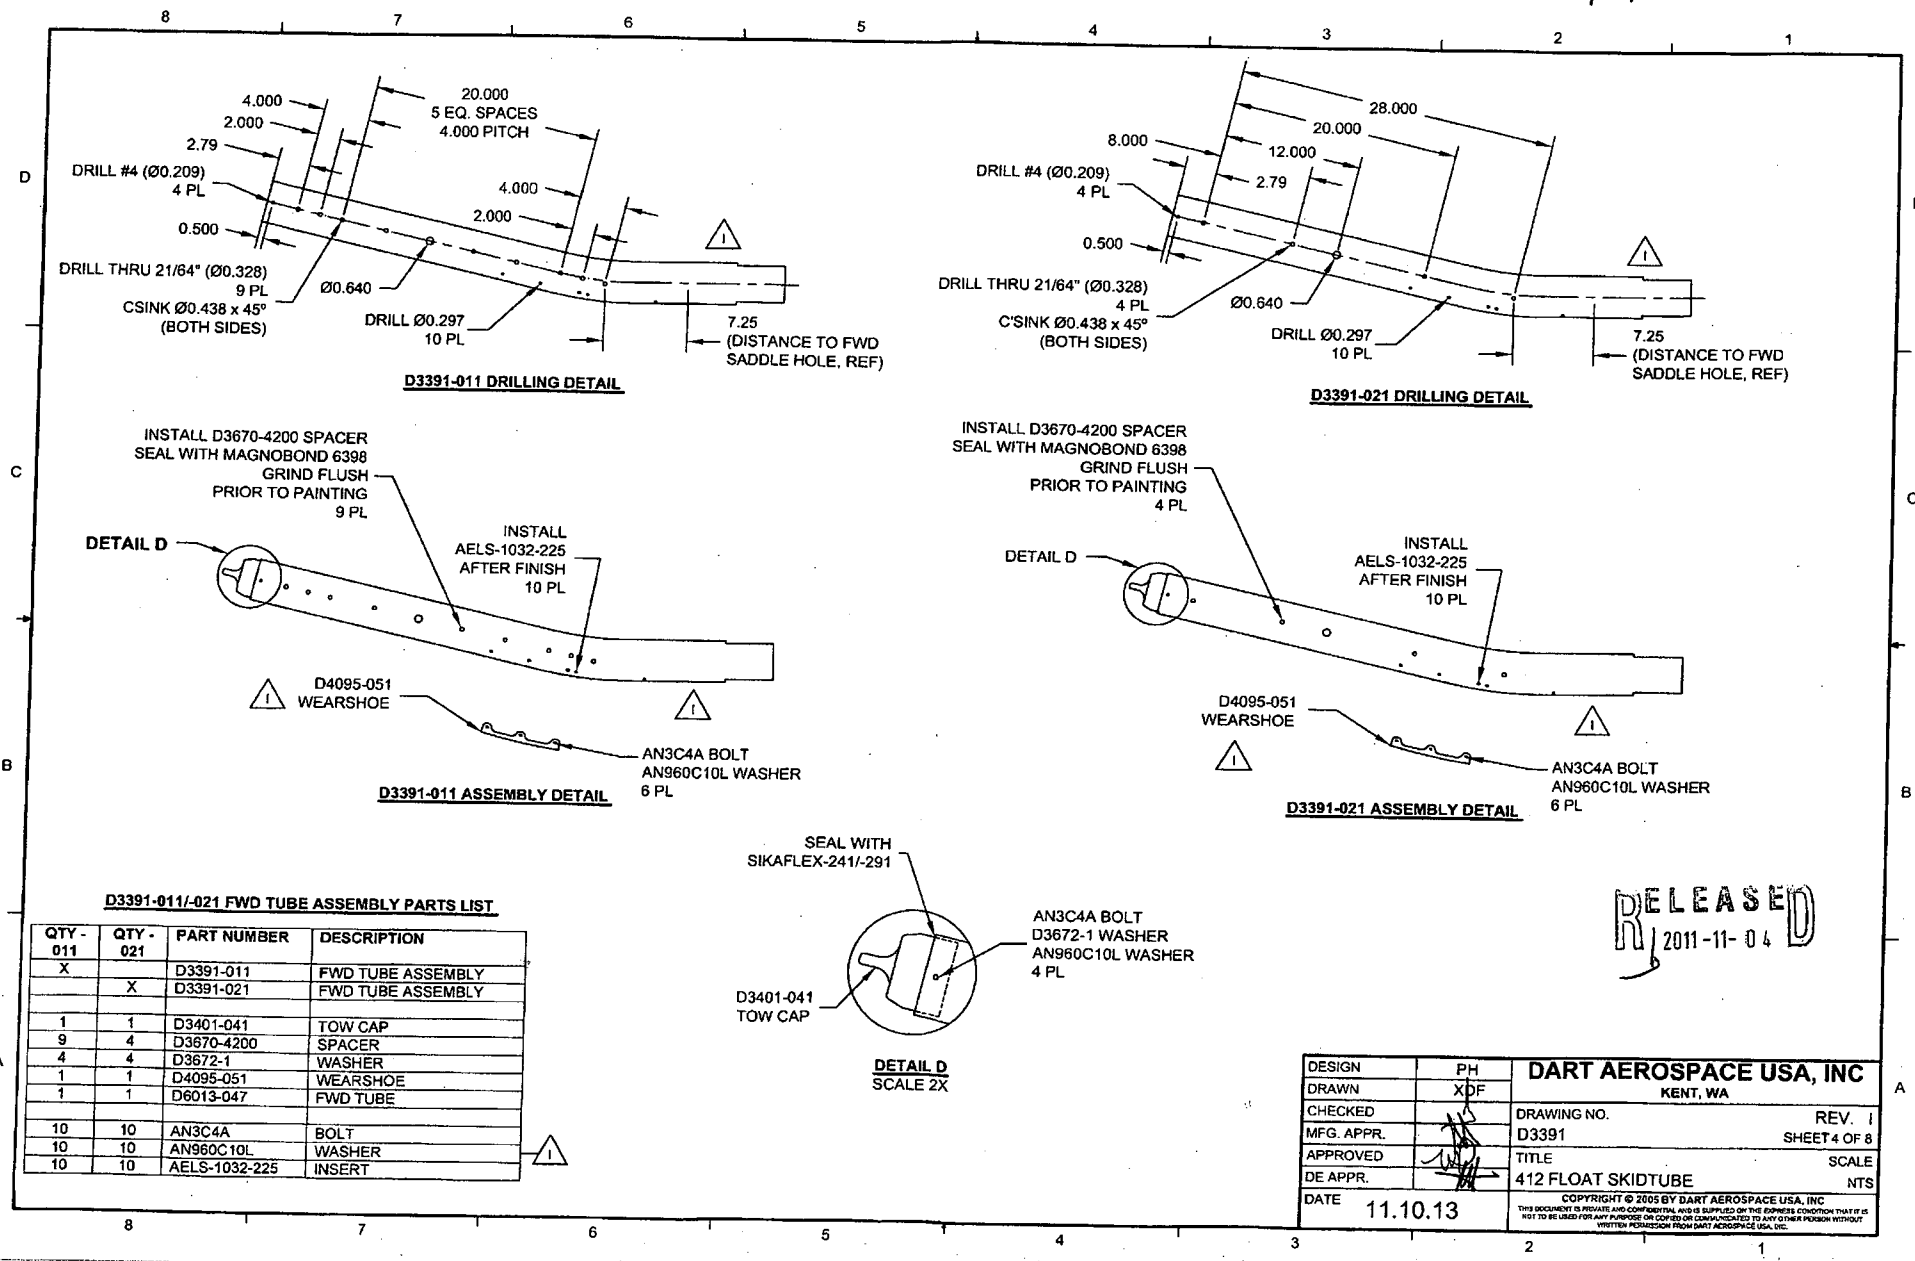

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			


NOTE: Date & initial all entries

77411

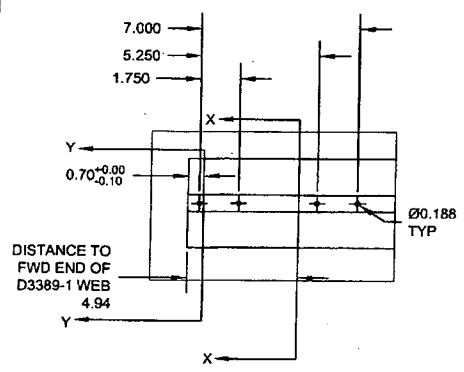


DETAIL J
SCALE 4X

DRILL THRU 21/64" (Ø0.328)
CSINK Ø0.438 X 45° (BOTH SIDES)
12 PL

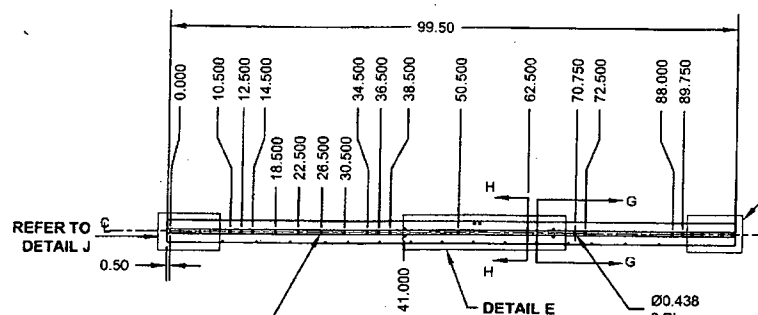


D3391-013 ASSEMBLY DETAIL
SCALE 5X

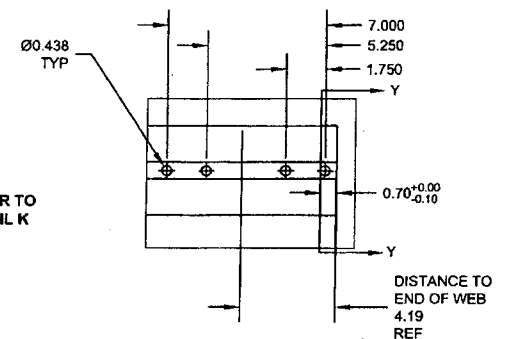


DETAIL K
SCALE 4X




SECTION G-G
SCALE 5X

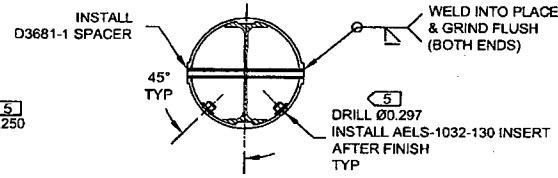

SECTION H-H
SCALE 5X

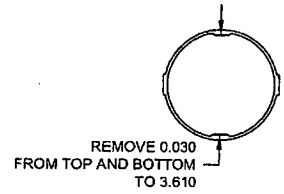


SECTION X-X
SCALE 5X

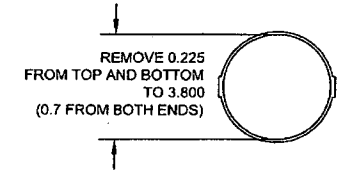


SECTION Y-Y
SCALE 5X

D3391-013 MID TUBE ASSEMBLY PARTS LIST

QTY	PART NUMBER	DESCRIPTION
X	D3391-013	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
4	D3672-1	WASHER
4	D3672-3	WASHER
12	D3681-1	SPACER
24	AELS-1032-130	INSERT
4	ALS4-428-165	INSERT
4	AN960C10L	WASHER
4	AN960C416L	WASHER
4	MS27039C1-09	SCREW
4	MS27039C4-08	SCREW

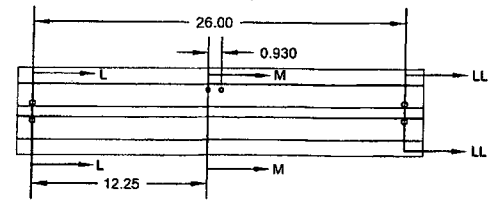


DETAIL E
SCALE NONE

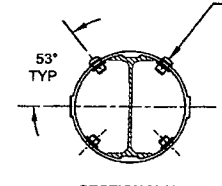


SECTION M-M
SCALE 5X

DRILL Ø0.297
INSTALL AELS-1032-130 INSERT
MS27039C1-09 SCREW
D3672-1 WASHER
AN960C10L WASHER
AFTER FINISH
4 PL

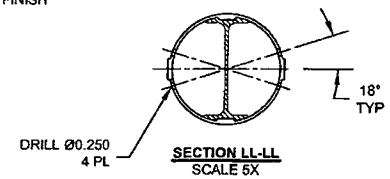

SECTION LL-LL
SCALE 5X

DRILL Ø0.391
INSTALL ALS4-428-165 INSERT
MS27039C4-08 SCREW
D3672-3 WASHER
AN960C416L WASHER
AFTER FINISH
4 PL

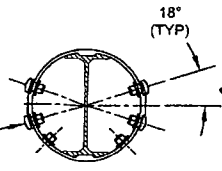

SECTION L-L
SCALE 5X

- D3391-013 MID TUBE ASSEMBLY**
- MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
 - INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/291 PER QSI 015
 - WELDING: PER DART QSI 004

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 5 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR DISCLOSED OR REPRODUCED IN ANY MANNER WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____


NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries


77411

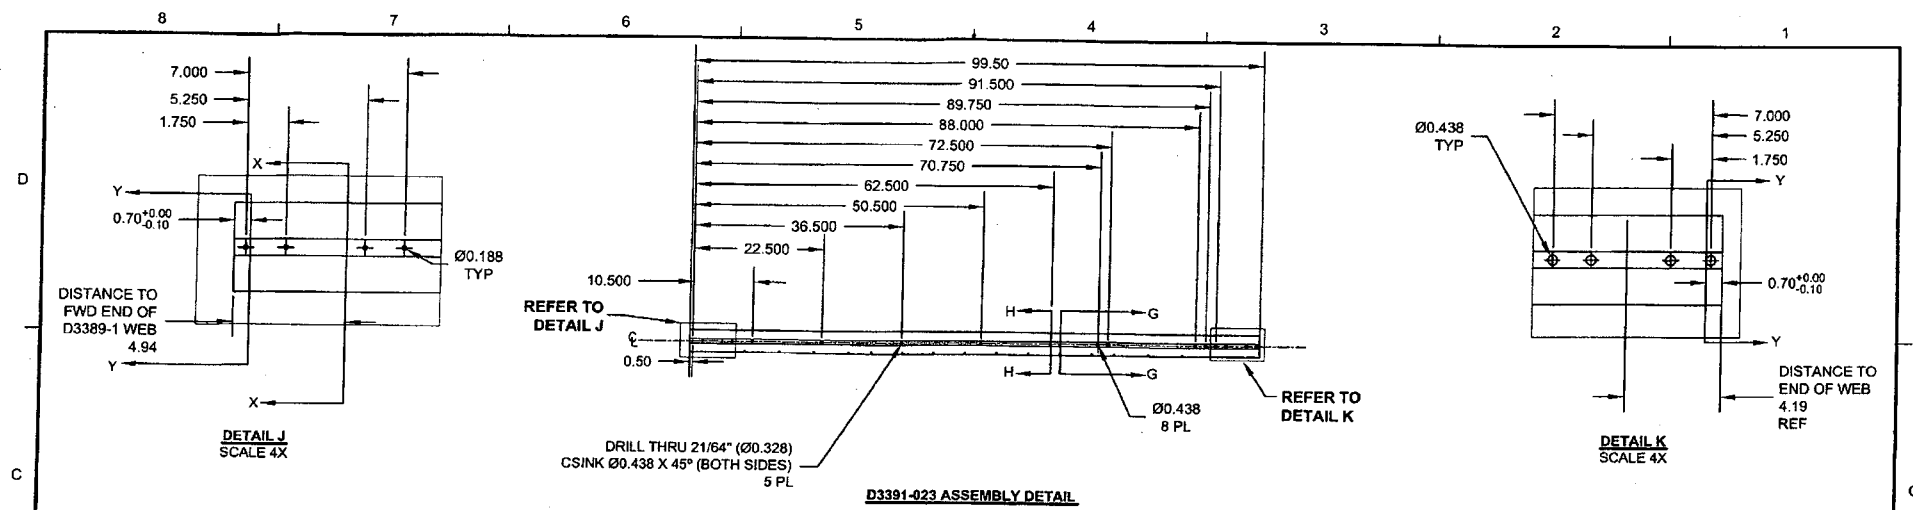


SECTION G-G
SCALE 5X

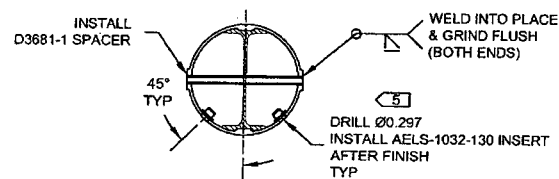

SECTION H-H
SCALE 5X

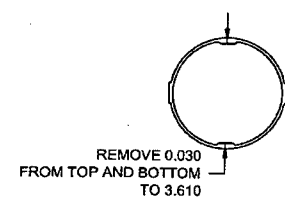

SECTION X-X
SCALE 5X

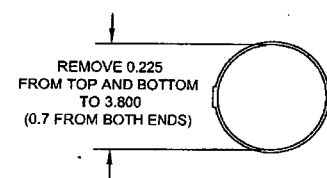

SECTION Y-Y
SCALE 5X

D3391-023 MID TUBE ASSEMBLY PARTS LIST

QTY - 023	PART NUMBER	DESCRIPTION
X	D3391-023	MID TUBE ASSEMBLY
1	D2500-1-100	EXTRUSION
1	D3389-1	WEB
5	D3681-1	SPACER
20	AELS-1032-130	INSERT

D3391-023 MID TUBE ASSEMBLY

- 1) MATERIAL: MAKE FROM D2500-1-100 EXTRUSION
- 2) INSTALL D3389-1 WEB TO OUTER TUBE USING SIKAFLEX-241/-291 PER QSI 015
- 3) WELDING: PER DART QSI 004

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC KENT, WA
DRAWN	XDF	
CHECKED		DRAWING NO. D3391
MFG. APPR.		REV. 1 SHEET 6 OF 8
APPROVED		TITLE 412 FLOAT SKIDTUBE
DE APPR.		SCALE NTS
DATE	11.10.13	

COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector


Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

77411

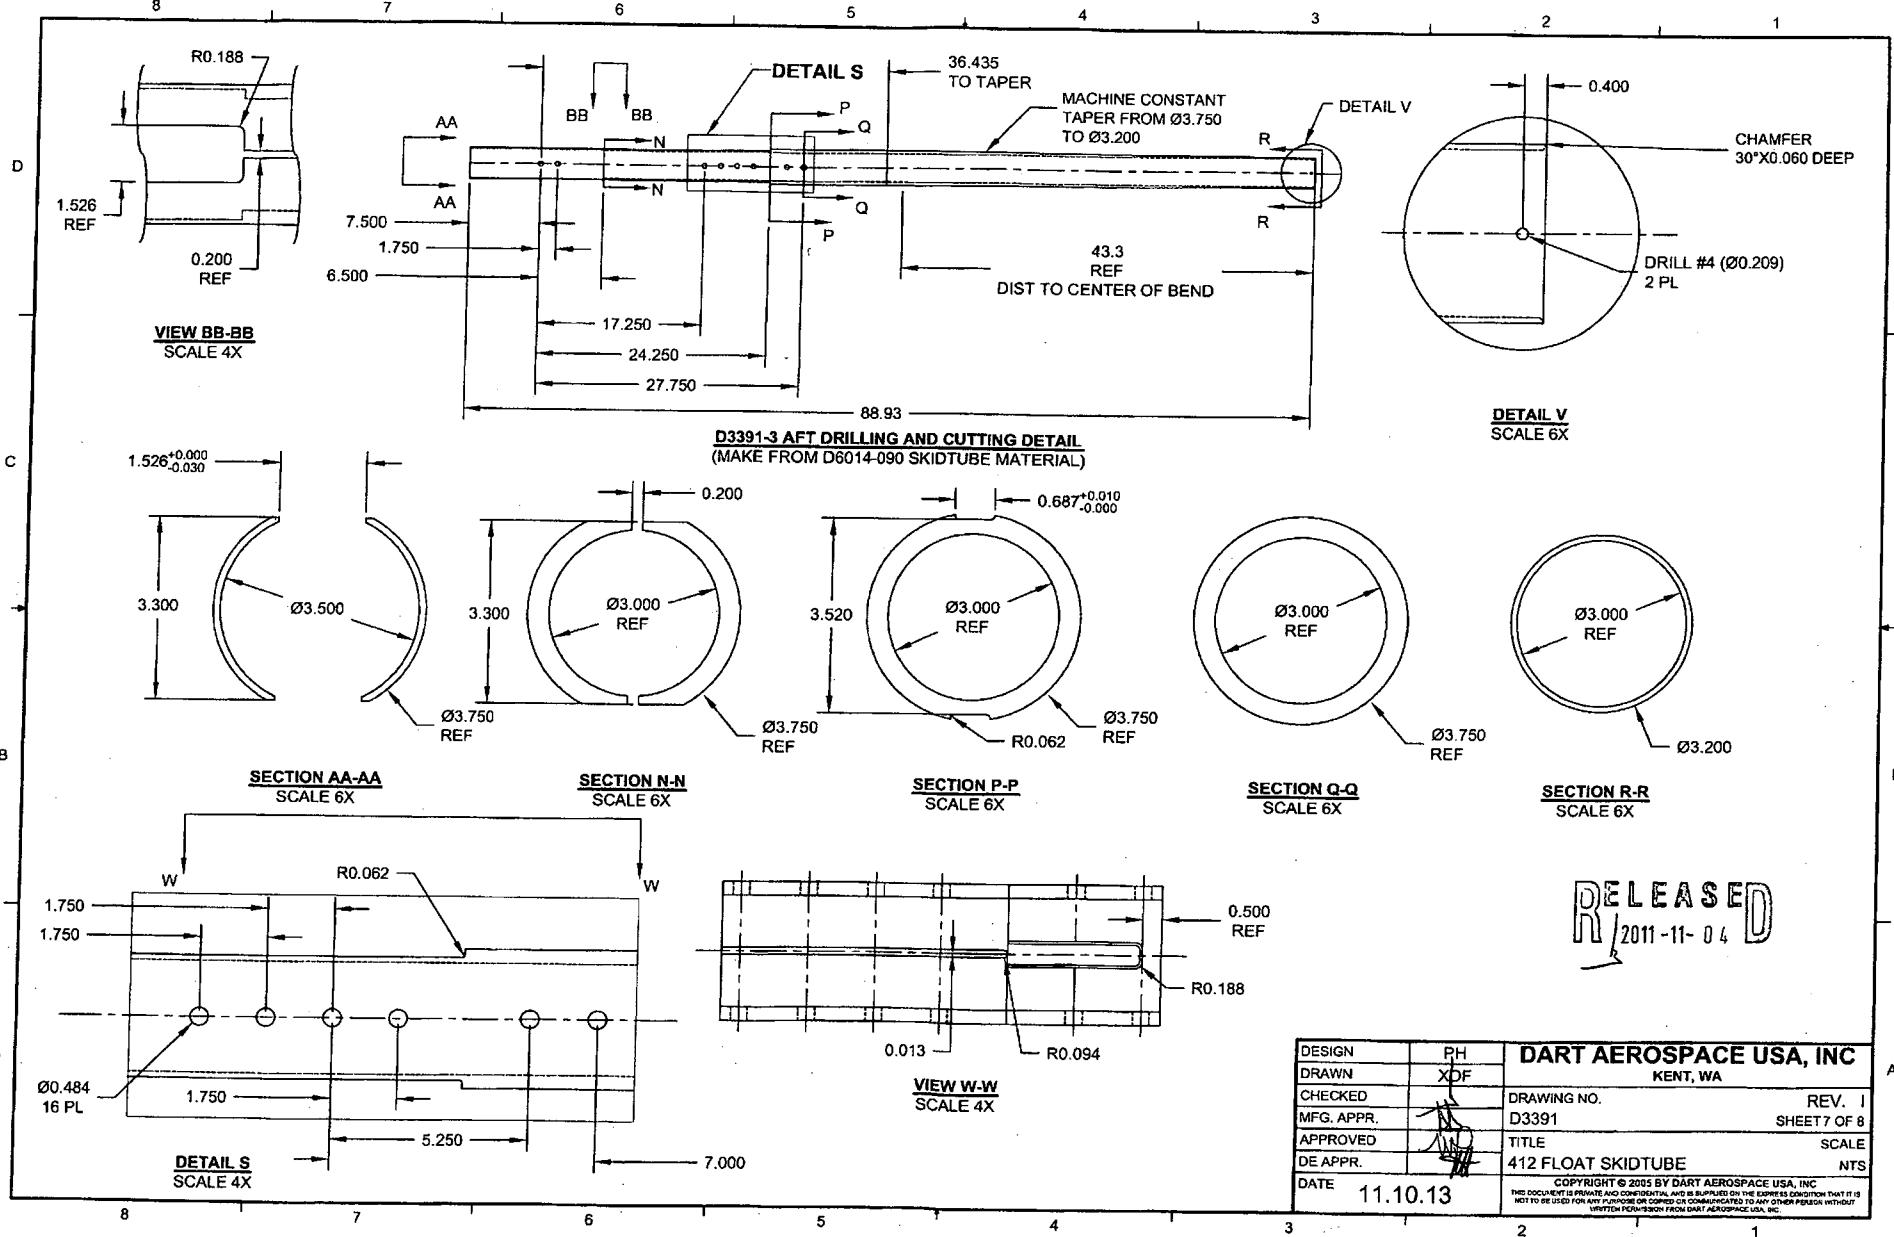

RELEASED
2011-11-04

DESIGN	RH	DART AEROSPACE USA, INC	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. 1
MFG. APPR.		D3391	SHEET 7 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	<small>COPYRIGHT © 2005 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR CORDED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.</small>	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

D3391-015 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
14 PL

D3391-025 BENDING AND DRILLING DETAIL
(SEE CBORE DETAIL BELOW)

INSTALL D3670-4200 SPACER
SEAL WITH MAGNOBOND 6398
GRIND FLUSH
PRIOR TO PAINTING
4 PL

D3391-015 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-025 ASSEMBLY AND CBORE DETAIL
(SEE TABLE)

D3391-015/-025 AFT TUBE ASSEMBLY PARTS LIST

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X	X	D3391-015	AFT TUBE ASSEMBLY
		D3391-025	AFT TUBE ASSEMBLY
1	1	D2646	AFT CAP
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
1	1	D4095-049	WEARPAD
1	1	D4095-047	WEARPAD
1	1	D6014-030	AFT TUBE
14	14	AELS-1032-130	INSERT
8	8	AELS-1032-225	INSERT
4	4	ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN960C10L	WASHER

**CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED**

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	8	8	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

RELEASED
2011-11-04

DART AEROSPACE USA, INC
KENT, WA

DRAWING NO. D3391
REV. 1
SHEET 8 OF 8

TITLE 412 FLOAT SKIDTUBE
SCALE NTS

DATE 11.10.13


COPYRIGHT © 2005 BY DART AEROSPACE USA, INC
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

QTY - 015	QTY - 025	PART NUMBER	DESCRIPTION
X		D3391-015	AFT TUBE ASSEMBLY
	X	D3391-025	AFT TUBE ASSEMBLY
1	1	D2646	AFT CAP
14	4	D3670-4200	SPACER
2	2	D3672-1	WASHER
1	1	D4095-049	WEARPAD
1	1	D4095-047	WEARPAD
1	1	D6014-090	AFT TUBE
14	14	AELS-10332-130	INSERT
8	8	AELS-10332-225	INSERT
4		ALS4-428-165	INSERT
6	6	AN3C4A	BOLT
4	4	AN3C5A	BOLT
10	10	AN560C10L	WASHER

CBORE HOLES MARKED CB1-CB4 AS FOLLOWS AND
INSTALL AELS-1032-XXX AFTER FINISH AS NOTED

HOLES MARKED	QTY D3391-015	QTY D3391-025	CBORE	P/N
CB1	8	8	Ø0.430 X 0.170	AELS-1032-225
CB2	4	4	Ø0.430 X 0.170	AELS-1032-130
CB3	6	6	Ø0.430 X 0.040	AELS-1032-130
CB4	4	4	NONE	AELS-1032-130

RELEASED
2011-11-04

DESIGN	PH	DART AEROSPACE USA, INC.	
DRAWN	XDF	KENT, WA	
CHECKED		DRAWING NO.	REV. I
MFG. APPR.		D3391	SHEET 8 OF 8
APPROVED		TITLE	SCALE
DE APPR.		412 FLOAT SKIDTUBE	NTS
DATE	11.10.13	COPYRIGHT © 2005 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR REPRODUCED IN ANY MANNER WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

Resolution: _____ Disposition: _____ QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

NO. 277

AWS D17.1.2001
QUALIFICATION TEST RECORD

Name: Barclay Elliott
Job number: 75959
Part number: D3391-023
Description: skid truck
Welding Process: Tig ☒ Mig ☐
Base material: Aluminum
Current: AC ☒ DC ☐

TEST REQUIREMENTS AND RESULTS

Visual: pass ☒ fail ☐
Penetration: pass ☒ fail ☐

UNACCEPTABLE

Cracks: pass ☒ fail ☐
Undercut: pass ☒ fail ☐
Pin holes: pass ☒ fail ☐
Overlap (cold lap): pass ☒ fail ☐
Porosity (surface): pass ☒ fail ☐
Coloration: pass ☒ fail ☐

Qualifier Bob Dunn Date of Test Coupon 11-12-16

Welder Barclay Elliott Date of Test Coupon 11-12-16

The above named individual is qualified in accordance with AWS D17.1.2001 to weld